CONTAC TOUGH - and TORRESONS				
Approved For Rel	ease 2002/10/ 25 3/0	A-RDIS\$4B0083		DD877
01 7 5	S E C	RET	1 // n	
6	e dans e deservos alemas areas areas.		3 20SA 4 2FA	12
			5 10EA	
10 1			6	14
t. Profes			8 <i>C</i> 3	
1				0. 37. 43.
ACTIONS			。 (1) (2) (2) (3) (3) (4) (4) (4) (4) (4) (4) (4) (4	
INFO \$				The state of the s
f				
	 .			
ING4011	OSA Commence and the commence of the		en telephonomic de la companya de l En la companya de la	er i centro consecuente a miesto comme de personal distribución de primera de servica con liverario. As acrosador mendigional acrossita de la consecuencia como con consecuencia consecuencia de la consecuencia de
70	mro		TI	
SECRET 290459	Z Clib.			
PRIORITY IN	F0			
IDEALIST MAINT-LOG	S LOW BLOC			
FROM				

25X1

25X1

25X1

25X1

REF:

I. PHYSICAL INSPECTION OF ENGINE 611434 REVEALS A HIGH DEGREE OF IMPACT DAMAGE. BOTH INTERMEDIATE AND DIFFUSER CASES WERE SPLIT OPEN. THE N2 GEARBOX WAS SHEARED OFF AND BROKEN IN SEVERAL PIECES. ALL N2 ACCESSORIES WERE BROKEN OFF FROM THEIR MOUNTING FLANGES. THE COMBUSTION CHAMBER CASE WAS CAVED IN DUE TO IMPACT DAMAGE AND WAS REMOVED BY CUTTING WITH A WELDING TORCH. REMOVAL OF THE BURNER CANS REVEALED THE FOLLOWING:

SENT 22 JUN 66

- A. ALL FIRST STAGE TURBINE NOZZLE GUIDE BANES WERE IN THE BOTTOM OF THE NOZZLE CASE, A FEW WERE FOUND IN THE NBR 4 AND NBR 5 BURNER CANS.
- B. FOUR ADJACENT FIRST STAGE TURBINE DISK CHRISTMAS TREE.
 RETAINING SEGMENTS FAILED RELEASING FIVE FIRST STAGE TURBINE.
 BLADES. THE REMAINING FIRST STAGE TURBINE BLADES HAVE APPROXI-

Approved For Release 2002/10/25: CIA-RDP74B00836RG00100040030-T

25X1

PAGE 2 SECRET 64011

MATELY ONE TO ONE AND A HALF INCHES OF BLADE TIPS MISSING.

DISK FAILURE APPEARS SIMILAR TO FAILURE IN ENGINE 661515.

- C. SECOND AND THIRD STAGE TURBINE BLADES ALL HAVE
 APPROXIMATELY ONE TO TWO INCHES OF BLADE TIPS MISSING, THE
 COMPLETE TURBINE SECTION HAS HEAVY FOD TYPE DAMAGE.
- D. FROM WHAT COULD BE INSPECTED THE FIFTEENTH STAGE EXIT VANES WERE INTACT AND APPEARED SATISFACTORY.
- E. REMOVAL OF THE NBR 6 BEARING HEATSHIELD DISHPAN
 REVEALED BOTH OIL PRESSURE AND SCAGENGE TUBES BROKEN OFF. THIS
 APPEARS TO BE THE RESULT OF ENGINE VIBRATION FOLLOWING DISK
 FAILURE.
- 2. THE ENGINE IS NOW READY FOR AIRLIFT TO PWA EAST COAST FOR FURTHER INVESTIGATION. THE BURNER CANS, N2 GEARBOX SECTIONS AND ENGINE ACCESSORIES ARE BOXED AND WILL ACCOMPANY THE ENGINE. THE REMAINING PARTS OF THE FIVE FIRST STAGE TURBINE BLADES ARE IN A BAG TIED TO THE FUEL NOZZLES.

 S E C R E T TOR: 290538Z JUN 66